HYGRASREG® KHT-30



Duct hygrostats and humidity and temperature sensors (± 2.0 %), incl. mounting flange, electronic, two-step, with multi-range switching and continuous/switching output



Electronic duct hygrostat and/or duct thermostat HYGRASREG® KHT-30 with a continuous and two switching outputs, adjustable switching thresholds and display for indicating ACTUAL humidity and/or ACTUAL temperature (accuracy class $\pm\,2.0\,\%\,\text{RH}\text{)}.$ The setpoints can be allocated to the relative humidity and/or to the temperature.

It is suitable for regulating and monitoring relative humidity (humidifying and dehumidifying) and/or the temperature (heating and cooling), e.g. in ventilation and air conditioning ducts, laboratories, production facilities, climatic test cabinets, indoor swimming pools, greenhouses, etc., to control humidifying and dehumidifying equipment or heating system control. The measuring transducers are designed for exact humidity/temperature measurement. The KHT-30 uses a digital, long-term stable sensor as a measuring element. It is used in dust-free, unpolluted, non-aggressive air.

Power supply:	24 V AC/DC (±20%)
Power consumption:	< 1,5 VA / 24 V DC, < 3,5 VA / 24 V AC
Sensor:	digital humidity sensor with integrated temperature sensor, low hysteresis, high long-term stability
Sensor protection:	plastic sinter filter, Ø 16 mm, $L = 35$ mm, exchangeable (optional metal sinter filter, Ø 16 mm, $L = 32$ mm)
Setting range:	595 % RH (humidity) Multi-range switching with 4 switchable measuring ranges (see table) -35+35 °C; -35+75 °C; 0+50 °C; 0+80 °C (temperature) (Switch steps 1 and 2 are separately adjustable)
Operating difference:	Mode 1: both switch steps are freely adjustable (rel. humidity) Mode 2: 5% between both switch steps (rel. humidity) Mode 3: both switch steps freely adjustable (temperature) Mode 4: switch step 1 (temperature), switch step 2 (rel. humidity) (adjustable via DiP switches)
Output:	potential-free changeover contacts (2x changeover contact 24V, 1A ohmic load, separately adjustable, 2x O-10V for U variant or 420mA for I variant)
Accuracy, humidity:	typically $\pm 2.0\%$ (2080% RH) at +25 °C, otherwise $\pm 3.0\%$
Accuracy, temperature:	typically ±0.2K at +25 °C
Ambient temperature:	storage $-35+85^{\circ}\text{C}$; operation $-30+75^{\circ}\text{C}$, non-precipitating
Long-term stability:	±1% per year
Housing:	plastic, UV-resistant, material polyamide, 30% glass-globe reinforced, with quick-locking screws (slotted/Phillips head combination), colour traffic white (similar to RAL 9016), housing cover for display is transparent!
Housing dimensions:	126 x 90 x 50 mm (Tyr 2)
Cable connection:	cable gland, plastic (M 16 x 1.5; with strain relief, exchangeable, max. inner diameter 10.4 mm) or M12 connector according to DIN EN 61076-2-101 (optional on request)
Protective tube:	PLEUROFORM TM , material polyamide (PA6), with torsion protection, Ø 20 mm, NL = 235 mm (optionally 100 mm), $v_{max} = 30$ m/s (air) (optional available on request stainless steel V2A (1.4301), Ø 16 mm)
Protection class:	III (according to EN 60 730)
Protection type:	IP 65 (according to EN 60529)
Electrical connection:	0.14 - 1.5 mm ² , via terminal screws
Standards:	CE conformity according to EMC directive 2014/30/EU
Display:	three-line display with illuminatio n, cutout approx. 70 x 40 mm (W x H), for displaying ACTUAL humidity and/or ACTUAL temperature or for setpoint adjustment
FUNCTION	
Humidifying/heating:	1st step: wire contacts 11-12. If actual humidity falls more than 3% RH/1K (hysteresis) below switching threshold S1, the changeover contact switches to 11-12.
	2nd step: wire contacts 21-22. If actual humidity falls more than 3% RH/1K (hysteresis) below switching threshold S2 the changeover contact switches to 21-22. Terminal 2: output relative humidity / terminal 3: output temperature
Dehumidifying/cooling:	1st step: wire contacts 11-13. When actual humidity exceeds switching threshold S1, the changeover contact switches to 11-13.
	2nd step: wire contacts 21 - 23. When actual humidity exceeds switching threshold S2, the changeover contact switches to 21 - 23. Terminal 2: output relative humidity / terminal 3: output temperature








KHT-30


S+S REGELTECHNIK

Duct hygrostats and humidity and temperature sensors (± 2.0 %), incl. mounting flange, electronic, two-step, with multi-range switching and continuous/switching output

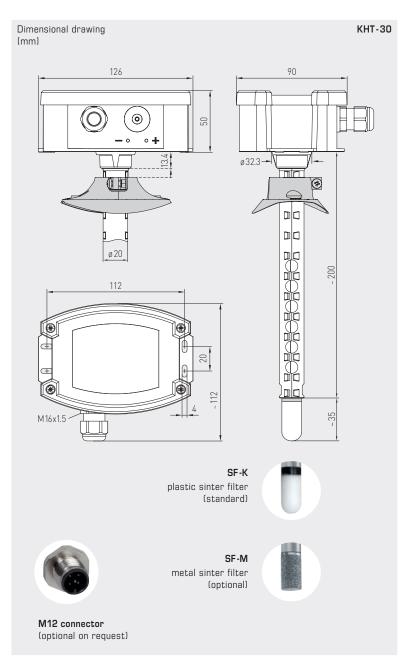





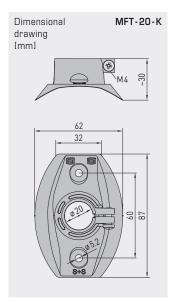

MFT-20-K Mounting flange, plastic

1 +49 (0) 911 / 5 19 47-0



Display readout

The 1st line of the display shows the ACTUAL humidity in % RH and the ACTUAL temperature in °C. The displays showing the ACTUAL values alternate in a 3-second rhythm. The resolution is 1/10 % RH or $1/10 {^{\circ}C}$.


The **3rd line** shows information about the switching status of relay 1 and 2 (as circuits) on the left, and on the right for the switching values of relay 1 and 2 in % RH or °C (adjustable via the corresponding set potentiometer). The reference to respective measured value (relative humidity or temperature) is determined by the mode selected.

For improved legibility, backlighting is provided.




Duct hygrostats and humidity and temperature sensors (\pm 2.0 %), incl. mounting flange, electronic, two-step, with multi-range switching and continuous/switching output



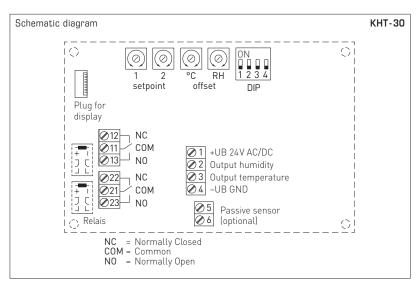

DIP switches	KHT-30	
Function mode	DIP 1	DIP 2
Mode 1 (2x 595%RH) (default)	OFF	OFF
Mode 2 (595 % RH + 5 % RH)	ON	OFF
Mode 3 (2x -35+80°C)	OFF	ON
Mode 4 (595 % RH / –35+80 °C)	ON	ON
Temperature range	DIP 3	DIP 4
−35+35 °C	OFF	OFF
0+80°C	ON	OFF
0+50°C (default)	OFF	ON
−35+75 °C	ON	ON



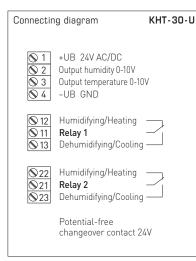


Supply		AC		DC	
	→ 1	24 V~		24 V DC	
→ 4		0 V		GND	
12	(∆1) →	Relay 1	Breake	r contact	
11	(W1) →	Relay 1	Changeover contact		
13	(B1) →	Relay 1	Normally open contact		
22	(A2) →	Relay 2	Breake	r contact	
21	(W2) →	Relay 2	Change	over contact	

Relay 2 Normally open contact

(B2) →

23

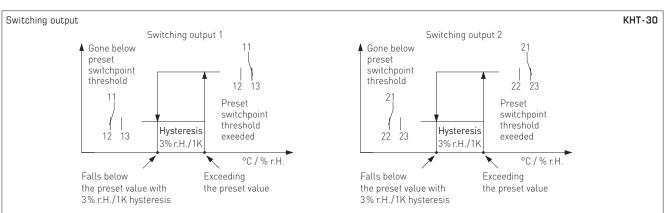


Mode 1: Independent switchpoints for both relay outputs can be defined in the range of 5...95 % RH by the control knobs (setpoint 1 for relay 1, setpoint 2 for relay 2, see schematic diagram). When the respective switchpoint is exceeded, the corresponding relay switches over (changeover contact 1 switches from position 2 to position 3). When the pre-set switchpoint is undershot again by more than 3 % RH (hysteresis), the respective switching output switches back to the initial position (changeover contact 1 switches from position 3).

Mode 2: In Mode 2, only control knob setpoint 1 is active (setpoint 2 without function)! The switchpoint for the first relay is defined in the range of 5...95 % RH by the control knob setpoint 1 (see schematic diagram). The switchpoint for the second relay output is invariably defined in mode 2 as "Switchpoint 1 + 5 % RH". Hysteresis of 3 % RH is also predefined for each switching output in mode 2.

Mode 3: Independent switchpoints within the temperature range (selectable via DIP switches) for both relay outputs can be defined by the control knobs (setpoint 1 for relay 1, setpoint 2 for relay 2). If the respective switchpoint is exceeded, the corresponding relay switches over. If the pre-set threshold value is undershot again by 1 K (hysteresis), the respective switching output switches back to the initial position. The thresholds of the setting range (temperature) are $5\,^{\circ}$ C above the minimum or below the maximum range value respectively.

Mode 4: In mode 4, the control knob is allocated to setpoint 1 of the temperature, while control knob is allocated to setpoint 2 of the relative humidity. The switchpoints can be set within the temperature range (selectable via DIP switches) or from 5...95% RH (humidity). The thresholds of the setting range (temperature) are 5° C above the minimum or below the maximum range value respectively.

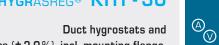

humidity and temperature sensors ($\pm 2.0\%$), incl. mounting flange, electronic, two-step, with multi-range switching and continuous/switching output









Temperature table	
MR: -35+75°C	

°C	U _A [V]	l_A [mA]
-35	0.0	4.0
- 30	0.5	4.7
- 25	0.9	5.5
- 20	1.4	6.2
- 15	1.8	6.9
- 10	2.3	7.6
- 5	2.7	8.4
0	3.2	9.1
5	3.6	9.8
10	4.1	10.5
15	4.5	11.3
20	5.0	12.0
25	5.5	12.7
30	5.9	13.5
35	6.4	14.2
40	6.8	14.9
45	7.3	15.6
50	7.7	16.4
55	8.2	17.1
60	8.6	17.8
65	9.1	18.5
70	9.5	19.2

remp	perature table	
MR:	−35+35°C	

°C	U _A [V]	l_A [mA]
-35	0.0	4.0
- 30	0.7	5.1
- 25	1.4	6.3
- 20	2.1	7.4
- 15	2.9	8.6
- 10	3.6	9.7
- 5	4.3	10.9
0	5.0	12.0
5	5.7	13.1
10	6.4	14.3
15	7.1	15.4
20	7.9	16.6
25	8.6	17.7
30	9.3	18.9
35	10.0	20.0

Temperature table MR: 0...+50 °C

°C	U _A [V]	l_A [mA]
0	0.0	4.0
5	1.0	5.6
10	2.0	7.2
15	3.0	8.8
20	4.0	10.4
25	5.0	12.0
30	6.0	13.6
35	7.0	15.2
40	8.0	16.8
45	9.0	18.4
50	10.0	20.0

Temperature table MR: 0...+80 °C

°C UA [V] IA [mA] 0 0.0 4.0 5 0.6 5.0 10 1.3 6.0 15 1.9 7.0 20 2.5 8.0 25 3.1 9.0 30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0 80 10.0 20.0			
5 0.6 5.0 10 1.3 6.0 15 1.9 7.0 20 2.5 8.0 25 3.1 9.0 30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	°C		
10 1.3 6.0 15 1.9 7.0 20 2.5 8.0 25 3.1 9.0 30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	0	0.0	4.0
15 1.9 7.0 20 2.5 8.0 25 3.1 9.0 30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	5	0.6	5.0
20 2.5 8.0 25 3.1 9.0 30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	10	1.3	6.0
25 3.1 9.0 30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	15	1.9	7.0
30 3.8 10.0 35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	20	2.5	8.0
35 4.4 11.0 40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	25	3.1	9.0
40 5.0 12.0 45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	30	3.8	10.0
45 5.6 13.0 50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	35	4.4	11.0
50 6.3 14.0 55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	40	5.0	12.0
55 6.9 15.0 60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	45	5.6	13.0
60 7.5 16.0 65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	50	6.3	14.0
65 8.1 17.0 70 8.8 18.0 75 9.4 19.0	55	6.9	15.0
70 8.8 18.0 75 9.4 19.0	60	7.5	16.0
75 9.4 19.0	65	8.1	17.0
	70	8.8	18.0
80 10.0 20.0	75	9.4	19.0
	80	10.0	20.0

Display Item No.

Humidity table MR: 0...100 % RH

% RH	U _A [V]	I_A [mA]
0	0.0	4.0
5	0.5	4.8
10	1.0	5.6
15	1.5	6.4
20	2.0	7.2
25	2.5	8.0
30	3.0	8.8
35	3.5	9.6
40	4.0	10.4
45	4.5	11.2
50	5.0	12.0
55	5.5	12.8
60	6.0	13.6
65	6.5	14.4
70	7.0	15.2
75	7.5	16.0
80	8.0	16.8
85	8.5	17.6
90	9.0	18.4
95	9.5	19.2
100	10.0	20.0

HYGRASREG® **KHT-30** Duct hygrostat and humidity and temperature sensor ($\pm 2.0\%$), *Deluxe*

Output

1,907 11002	Humidity	Temperature	Gaspas	01000	Biopidy	100111140.	11100
KHT-30-I						I-variant	
KHT-30W-I LCD	595 % RH	-35+75°C -35+35°C 0+50°C 0+80°C	2 x changeover contact, 2x 420 mA	two-step		1202-8127-2421-000	252,61 €
KHT-30-U						U-variant	
KHT-30W-U LC	595 % RH	-35+75°C -35+35°C 0+50°C 0+80°C	2 x changeover contact, 2x 0-10 V	two-step		1202-8127-1421-000	252,61 €
Optional:	Cable connection with			76-2-101		on request	
	shortened protective to	ibe PLEURUFURN	\mathbf{I}^{TW} , $\mathbf{NL} = \mathbf{IUU} \mathbf{mm}$			on request	

ACCESSORIE

Rev. 2025 - V28 GB

75

Type/WG02

10.0

20.0

SF-M Metal sinter filter, \emptyset 16 mm, L = 32 mm, exchangeable, stainless steel **V4A** (1.4404)

1 +49 (0) 911 / 5 19 47-0

Setting Range



Steps

45,34 €

7000-0050-2200-100

Price